

# **Condition Assessment Report**

**Portsmouth Civic Center Complex** 



April 29, 2019 CN# 8305



# CLARKNEXSEN

4525 Main Street, Suite 1400 Virginia Beach, VA 23462

# **Table of Contents**

Project Description	
Executive Summary	
Police Headquarters	3
Plaza Level	5
Judicial Building A	7
Judicial Building B	9
Jail	11
Magistrate	14
Garage	16
APPENDICES	19
APPENDIX A – TABLE OF CONTENTS, PHOTOGRAPHS	
APPENDIX B – CONCEPT COST ESTIMATE	



## **Project Description**

The City of Portsmouth has tasked Clark Nexsen with performing a partial condition assessment of the City's "OLD" Civic Center. Our scope is limited to Building Structure, Shell (exterior envelope and roof), and Life Safety functions (ingress/egress) of the facilities, as we understand the City of Portsmouth is contracting with other local design professionals and hazardous materials testing firms for the remainder of the facility assessment. The intent of this document is to document the existing conditions at each facility, specifically, items requiring maintenance, repair or replacement. This will be used to assess funding requirements for repairs at these facilities and to guide in future decision making.

The initial step in these assessments required gathering data of the existing conditions. This effort was limited to visual examinations at each of the facilities by licensed professionals over two (2) separate site visits, on February 25th and March 7th, 2019. Observations and input from Department of Public Works, Sheriff and Police staff members familiar with the each of the facilities being assessed was also included in this assessment.

After initial data gathering, our team evaluated each component to: (1) identify issues or repairs needed, (2) develop recommended repairs, and (3) estimate construction costs for recommended repairs.

Finally, the information was compiled to summarize each evaluation and to provide a concise funding document for reference.

Limitations: These evaluations and costs were prepared based on limited information. The assumptions and recommendations in this report are based on the professional experience of the authors. This report is offered in good faith, with the understanding that Clark Nexsen assumes no responsibility for concealed defects, the accuracy of any budgetary costs, or the use of the report in any manner other than that intended by the author. A licensed architect or engineer specializing in the work being performed should be engaged prior to performing any of the work discussed herein.

## **Executive Summary**

Built between 1966 and 1970 as part of an urban renewal strategy, the Portsmouth Civic Center Complex is nearly 50 years old and at the end of its design life span. Although improvements and upgrades have been implemented over the past 49 years, the structures and their systems have either already failed or are in the process of failing and require an increasing amount of maintenance or replacement to keep them in an acceptable operating condition. In 2012, the Civic Center's Judicial functions – including courts, offices for the Commonwealth's Attorney, the Sheriff's Office and court services – relocated the Civic Center to the new Portsmouth Judicial Center at 1345 Court Street. The space vacated by these functions was partially renovated to support other City services such as Portsmouth Police Department property and evidence, uniformed patrol offices the Magistrates offices and City File storage.

The Portsmouth City Jail sits in the center of the complex and is an aged facility for which the Sheriff's Office achieved an overall compliance rating of 100% from the Virginia Department of Corrections in 2016. However, continuing compliance will likely become more difficult in the future due to the continued aging of the facilities and its systems. Building systems technology has advanced significantly during the jail's life span and existing systems have been repaired and/or replaced in order to be as efficient as possible within the limitations of the building's structure and construction type. Those systems will soon reach the end of their useful life expectancy as well.

#### Immediate Repair Needs:

Water infiltration is the primary factor deteriorating the former Portsmouth Civic Center. Uncontrolled ground and rain water is actively eroding the entire facilities concrete structure, steel roof structures and masonry wall systems. Until the flow of water is stopped the entire facility will continue to degrade and therefore should be the initial phase of any renovation project planned for the complex.

Concrete:	\$1,751,009.00		
Moisture & Thermal Protection:	\$2,615,475.00		
Subtotal:	\$4,366,484.00		

Note: The concrete repair estimate is based on a visual survey only and may be subject to change based on unforeseen conditions.

#### Remaining Continued Use of Building Repair & Replacement Needs:

All other repairs and replacements identified in this report should be undertaken immediately following the entire facility being waterproofed and mechanical systems made operational (as identified in another design firms report). Without mechanical dehumidification the rampant water infiltration will continue to grade the entire facility.

Subtotal remaining repair budget:	\$36,425,858.00
Total:	\$40,792,342.00

Given the City Jail is the only part of the complex which is being used as originally designed / constructed coupled with the fact the Courts and Police Headquarters have been moved to other facilities. We recommend the City strongly consider their options before spending nearly \$41-million dollars to partially renovate a purpose-built municipal facility which is largely vacant and no longer being used to support the municipal functions for which it was originally designed.

#### **Police Headquarters**

711 Crawford Street (referred to as former Police Headquarters, Traffic Court, Civil Court and General District Courts)

Built: 1966-1970



#### Architectural:

The former Police Headquarters, Traffic Court, Civil Court and General District courts is only partially occupied. The basement level is fully occupied and houses Police Operations, Evidence Storage, Sheriff's Department Administrative functions. The first floor or plaza level is approximately fifty percent occupied and supports the Police records and Operations Support Units as well as administrative office spaces. The second floor is currently not being used.

It is apparent that the roof, exterior walls and windows leak badly. See photos HQ-1 through HQ-14. Although it may not be obvious, the center area ceiling in some areas has fallen or sunken approximately 6" below the adjacent ceiling areas. See photo HQ-8. Water leaks in the basement area Police Evidence storage spaces show significant flooding over an extended length of time. See photos HQ-11, HQ-12, HQ-13 & HQ-14. Some of the exterior wall and window leaks can be attributed to the apparent use of non-water proof construction to fill a former window opening after a residential window style air conditioner was installed. See photo HQ-15.

In the basement level Police Evidence storage areas there is significant visual evidence of rodent and insect infestation. In many cases illegal drug evidence which has been opened and partially eaten by rodents. See photos HQ-11 & HQ-16. Insect infestation is visible throughout the building. See photo HQ-17.

The publicly accessible elevator servicing the building is not in working order. See photo HQ-18. Recommended actions:

- Replace and replace all existing roofing and flashing.
- Remove residential window mounted air-conditioning unit. Provide a commercial equivalent
  which does not have to be window mounted. Remove plywood closure. Replace all windows with
  thermally broken window systems and energy efficient glazing.
- Provide code compliant vapor and thermal barrier systems at all exterior surfaces.
- Demolish all existing water damaged interior partitions/ finishes and replace with new to suit current use.
- Inspect all exterior precast concrete elements and replace damaged sections and/or attachments.
- Replace previously removed precast concrete elements to match existing.
- Renovate existing elevator systems.

#### Fire Protection:

The former Police Headquarters, Traffic Court, Civil Court and General District courts building is partially sprinklered, with the only sprinklers located at the basement level. This sprinkler piping appeared to be supplied from one of the garage dry pipe sprinkler systems, both of which are currently tagged "out of service." See photos G-17 and G-18.

No fire alarm initiating devices (manual pull stations, smoke detectors, etc.) were observed, but there are a minimum number of fire alarm notification devices. The few notification devices that are present are insufficient to satisfy current requirements of NFPA 72 or the Americans with Disabilities Act.

- Extend sprinkler protection throughout the first and second floors
- Restore sprinkler protection in the basement to service
- Provide a new fire alarm system throughout the building, including notification devices in all
  public (restrooms, lobbies, waiting areas, etc.) and common use spaces (defined as any space
  routinely used by more than two employees).

#### Plaza Level

711 Crawford Street Built: 1966-1970



#### Architectural:

The Plaza Level consists of a two-city block open pedestrian plaza which is accessed by several monumental stairs and a single accessible ramp. Construction generally consists of precast concrete wall and walkway panels and precast concrete planter boxes along the perimeter of the plaza.

All construction appears to be original to the complex with only minor maintenance consisting primarily of sealant at joints between the precast concrete panels. This sealant appears to have exceeded its useful life span and is failing. See photo PL-1

Based on evidence of significant water leaks at the Basement Level of the complex it appears the original waterproofing under the perimeter precast concrete walls and walkway panels have failed and, in some areas, precast panel steel anchors have become exposed and are rusting which has allowed precast concrete elements to loosen and, in several locations, fall off the building. See photos, PL-2, PL-3, PL-4, PL-5, PL-6 & PL-7

The plaza level drainage system is not functioning properly. This is evident by the fact it had not rained in several days prior to our field investigation and standing water was visible in several locations. This is undoubtably contributing to the basement level leaks. See photos PL-8 & PL-9.

As previously noted, the perimeter of the plaza level is lined with precast concrete planer boxes. These planter boxes have a water proofing membrane and internal drains. A few contain soil and plantings but most are empty, except for trash and the water proofing membrane is exposed and obviously failing. One of the planter boxes is filled with water. See photos PL-10 & PL-11.

#### Recommended actions:

- Remove all precast concrete pediment wall and paver panels. Remove and replace all existing waterproofing. Provide new precast concrete pediment wall and paver panels to match existing.
- Remove and replace all water proofing in planters.
- Repair and/or replace existing plaza level and planter drainage piping as required to provide proper operation.

#### Fire Protection:

Fire department connections for the building sprinkler and standpipe systems are located on the face of the plaza podium along Crawford and Water Streets. Several of the inlet connections are missing caps, which can allow dirt, debris and trash to get into the system, whether accidentally or maliciously.

- Inspect the inside of the inlet connections and remove any visible debris.
- Replace any missing caps. As metal caps are sometimes stolen, consider the use of plastic "breakaway" type covers to reduce any incentive to steal them (subject to fire department concurrence).

## Judicial Building A

601 Crawford Street (referred to as Circuit Courts Building)

Built: 1966-1970



#### Architectural:

While on site to conduct our field investigation, Clark Nexsen staff met with the Director of Public Works to coordinate access to the former Circuit Courts Building (Judicial Building A). The Director of Public Works advised that due to bio-hazard safety concerns access to the building would not be permitted and that the building had not been occupied for several years and the building was not safe.

In lieu of visual inspections to the access constraints, we were told by our Portsmouth Police Department escort that he had seen a significant crack in the exterior wall of the building which extended from the roof to the plaza level. The opening was wide enough to allow daylight to enter the building. He also commented that the second floor in the central lobby area had settled several inches downward, due to what he termed as a structural failure.

- Remove and replace all existing roofing and flashing.
- Provide code compliant vapor and thermal barrier systems at all exterior surfaces.
- Demolish all existing interior partitions/ finishes and replace with new to suit current use.
- Inspect all exterior precast concrete elements and replace damaged sections and/or attachments.
- Replace previously removed precast concrete elements to match existing.

- Determine nature and extent of all structural failures and make appropriate repairs.
- Renovate existing elevator systems to like new condition.

#### Fire Protection:

Based upon a review of the as-built drawings for the complex and conditions in other buildings, it is unlikely that this building is un-sprinklered.

Unless a new fire alarm system has been provided in the last twenty years or so, it is unlikely that any fire alarm system would meet current notification requirements of NFPA 72 or the Americans with Disabilities Act.

- Provide a new wet pipe sprinkler system throughout the building.
- Provide a new fire alarm system throughout the building, including notification devices in all public (restrooms, lobbies, waiting areas, etc.) and common use spaces (defined as any space routinely used by more than two employees).

## Judicial Building B

606 Water Street (referred to as Police Department Property & Evidence and City File Storage)

Built: 1966-1970



#### Architectural:

The Police Department Property and Evidence Storage and City File Storage areas are in good condition given the fact both areas were renovated during the past few years. Although the building was not designed for storage, the Police Department has optimized the use of the space. See photo JB-1.

The second floor of the building has been completely gutted back to the structure and the space is being used as City File Storage. See photo JB-2. When the demolition took place apparently piping was removed that penetrated a fire rated masonry wall surrounding one of the two exit stairs. This remaining opening has voided the fire separation. See photo JB-3.

- Replace and replace all existing roofing and flashing.
- Provide code compliant vapor barrier and thermal barrier systems at all exterior surfaces.
- Inspect all exterior precast concrete elements and replace damaged sections and/or attachments. Replace previously removed precast concrete elements to match existing.
- Repair all fire rated construction.
- Renovate existing elevators to like new condition.

#### Fire Protection:

The Police Department Property and Evidence Storage and City File Storage areas are not sprinklered.

Some new fire alarm notification devices were noted, but the coverage does not appear to fully meet the requirements of NFPA 72 or the Americans with Disabilities Act. See photo JB-4.

- Extend sprinkler protection throughout the building,
- Provide a new fire alarm system throughout the building, including notification devices in all
  public (restrooms, lobbies, waiting areas, etc.) and common use spaces (defined as any space
  routinely used by more than two employees).

<u>Jail</u>

701 Crawford Street (Jail tower, plaza level administrative spaces and basement level Jail facilities)
Built: 1966-1970



#### Architectural:

The Portsmouth City Jail is made up of an eight-story inmate housing tower with inmate intake, and administrative spaces in the basement level. The original design of the jail's plaza level consisted of a small public jail entrance and visiting area, elevator and two stairways. At some point likely during the 1980's an administrative addition was added at the plaza level to fill in the space between the Jails two stair towers.

The exterior brick and precast concrete elements jail appear to be in good and serviceable condition but after further investigation appears to be holding a significant amount of water. Although, it was well above freezing during our field investigation a large ice formation had grown down from the Jail tower. See photo J-1. Excessive water under the brick is also evident by extensive efflorescence on the east side of the building. See photo J-2. Extensive finish discoloration and water stains are also visible on several of the plaza level soffits. See photos J-3 & J-4.

On the roof there appears to be a relatively new white membrane roof. The details used to seal the mechanical equipment curbs are no longer water tight. See photo J-5. The original design included a pair of mechanical equipment screens and their removal has left openings in the brick which are not water tight. See photo J-6. The roof access door and frame are significantly rusted to the point they are rusted shut and can not be easily opened. See photo J-7.

The heavy steel correctional windows are not thermally broken and have single pane glass which is not energy efficient. Their location behind precast concrete screen walls have made maintenance difficult and their painted finish shows signs of significant deterioration. See photo J-8.

The inmate housing areas appear to be serviceable and well maintained. See photos J-9 & J-10.

It would appear fire stopping between floors and adjacent spaces is missing in numerous locations. See photos J-11 & J-12.

On the basement level of the Jail there continues to be significant evidence of water leaks which are active and causing significant damage to the building's structure. See photo J-13. Photos J-14 & J-15 should be reviewed together as J-14 shows a significantly active water leak from the Plaza Level above and how the concrete slabs reinforcing has rusted, swollen and has fractured the concrete. In Photo J-15 mineral deposits from the leak above are forming stalagmites on the floor surface below.

In several basement areas the floor slabs are showing signs of significant deterioration, most likely from standing water from an adjacent floor drain. See photo J-16.

#### Recommended Actions:

- Remove and replace all existing roofing and flashing.
- Investigate water within the exterior masonry cavity and replace existing flashing and waterproofing as required.
- Replace existing plaster soffits under inmate tower to match existing.
- Replace existing storefront system at plaza level with a thermally broken system with energy efficient glazing.
- Provide waterproof closure at former mechanical screen system on roof.
- Repair existing cooling tower support frame and repaint.
- Repair all fire rated construction.
- Repair and/or replace as required all existing reinforced masonry concrete construction damaged by water.
- Inspect all exterior precast concrete elements and replace damaged sections and/or attachments.
   Replace previously removed precast concrete elements to match existing.
- Repair and repaint all existing steel correctional windows. Replace existing glazing with a suitable energy efficient system.

#### Fire Protection:

Except for a small area at the basement level, the jail is un-sprinklered. See photo J-17 for this area of the building.

Fire standpipes are in the north and south stairwells of the jail. Fire hose valves are located inside the stairwells at each main landing, and there are also fire hose cabinets located outside of the stairwells at floors 2-8. According to the as-built drawings, supply piping to these stairwells is run below the garage parking level from the mechanical equipment room to the two stairwells.

The fire alarm control panel appears to be relatively new. See photo J-18 for the fire alarm control panel. Fire alarm notification does not appear to fully meet the requirements of NFPA 72 or the Americans with Disabilities Act for notification in public and common use areas.

- Extend sprinkler protection throughout the jail. It appears that the fire standpipes are "wet," so depending on the capacity and boost of the fire pump it may be possible to supply sprinklers from one of the existing standpipes.
- Current codes do not allow fire service piping to be run below buildings unless special provisions
  are taken. Therefore, we recommend that new supply piping be provided above the parking level
  slab to supply the standpipes. If any of this piping is run through unconditioned space, provide
  heat tracing for the exposed piping.
- Extend fire alarm notification to public and common use areas as necessary to meet current NFPA 72 and Americans with Disabilities Act requirements.

## Magistrate

711 Crawford Street (an addition between Judicial Buildings "A" and "B" originally designed as security screening areas and additional courtrooms)

Built: 2003



### Architectural:

The Magistrate Area is an addition located at the Plaza Level between the Judicial Building A and B. The general condition of this area is extremely good given its relative age compared to the remainder of the Civic Center Complex.

There is evidence of roof leaks where the addition abuts the two existing Judicial buildings. See photo M-1.

- Repair and/or replace existing roof flashing where addition ties into the pre-existing Judicial buildings.
- Replace all water damaged interior finishes.

#### Fire Protection:

The Magistrate Area is not sprinklered.


No fire alarm system or notification was apparent.

- Extend sprinkler protection throughout the building,
- Extend fire alarm throughout the building, including notification devices in all public (restrooms, lobbies, waiting areas, etc.) and common use spaces (defined as any space routinely used by more than two employees).

## Garage

referred to at Police Basement & Courts Basement

Built: 1966-1970

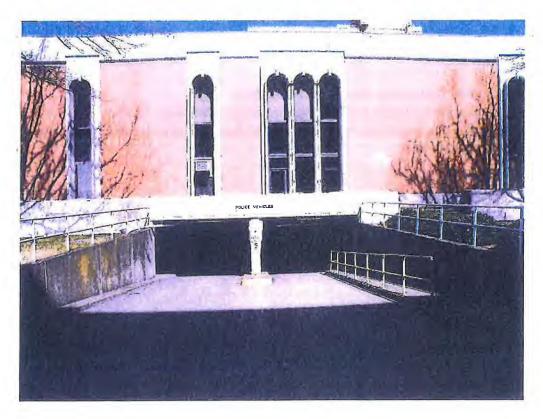

#### Architectural:

Since the basement level covers the full two city block area of the civic center complex the following narrative will be broken up into two parts. These parts are the Police Basement, which is the southwest side of the basement level, and the Courts Basement, which comprises the remainder of the civic center basement level.

#### Police Basement:

Due in part to the 24-hour per day, 7-day a week operation of the Portsmouth Police Department, the Police basement parking area floor is subjected to significant wear from Police and Sheriff department vehicle traffic loading on the basement floor pavement. Some of the concrete slabs have been repaired. See photo G-1. As these concrete slabs continue to wear, concrete debris covers the floor slabs and this debris has filled and clogged the floor drains to the point they no longer function. See photo G-2.

As previously referenced, water leaks from the Plaza Level have significantly deteriorated the concrete structure of the poured in place concrete Plaza Level floor and Basement Level overhead structure. See photos G-3 & G-4. As previously noted, it had not rained for several days prior to our site investigation but running and standing water was visible. In one area water was leaking onto and standing around a large electrical transformer. See photos B-5 & B-6. This ongoing and deteriorating condition is evident by the

stacking of sandbags around critical police department access doors leading from the Police Basement parking garage into critical Police operational areas. See photo B-7.

#### Courts Basement:

Many of the issues noted in the Police Basement are also evident in the Courts Basement. Long term uncontrolled running and standing water also threatens critical city infrastructure. See photos G-8, G-9 & G-10.

It was noted that the only in-service elevator from the Courts Basement up to Police Evidence Storage had recently failed an elevator inspection, however, the elevator was still in operation and parts had been ordered. See photo G-11.

Further examples of long-term uncontrolled water leaks are evident by plastic sheets shedding water from the Civic Center's main telecommunication room equipment. See photo G-12.

While touring the Police Department's former dispatch center and civil defense shelter, escorts from the Portsmouth Police department indicated that access was not permitted to the former Police Dispatch room because it had been condemned and sealed due to a rampant and out of control mold problem.

While touring the Civic Center's main mechanical room, which is several steps lower than the remainder of the basement level, there was evidence of fire rated wall construction which had been impacted by removal of fire rated pipe penetrations through a masonry wall. The opening is now covered by a metal sign which has impacted the fire separation. See photo G-13. In this same room there was evidence of the Civic Center's main electrical distribution center having been flooded on what appeared to be numerous occasions. See photo G-14. Water leaking from above has apparently threatened numerous electrical and mechanical systems which is evident by a metal shield which is partially protecting a pump. See photo B-15.

Although small, possibly the most serious issue detected while touring this area was standing water at the base of a building column and a crack in the column, as there was no apparent evidence of something striking the column to cause the damage. The most likely cause of the crack is prolonged exposure to water seeping into the concrete and caused the reinforcing steel to rust and deteriorate. Typically, when this happens the steel swells as it corrodes and has apparently cracked the concrete. See photo G-16.

- Repair and/or replace existing reinforced masonry concrete construction damaged by water.
- Repair all fire rated construction.
- Replace all existing water damaged interior partitions/ finishes.
- Repair and/or replace existing drainage piping as required to provide proper operation.

#### Fire Protection:

The garage is provided with two dry pipe sprinklers, although the systems are currently tagged "out of service." See photos G-17 and G-18. The piping shows signs of exterior corrosion, and the internal condition of the piping is unknown. See photo G-19. The sprinkler heads also show some signs of surface corrosion, so it is possible that they won't activate properly in the event of a fire. NFPA has requirements for periodic testing of sprinkler heads, with a more frequent interval for sprinkler heads subject to harsher environments.

No fire alarm notification was apparent in the garage.

- Replace the sprinkler systems in their entirety, including all piping, valves and sprinkler heads.
- Extend fire alarm notification throughout the parking areas.

# **APPENDICES**

						•
			+			5
						*
						1
		*				
					×	*
Ť.						(F)
4						
					*	
				.00		
		2				
			50			
		3		16		
	*					

# APPENDIX A – TABLE OF CONTENTS, PHOTOGRAPHS

	Police HeadquartersHQ	
0	Plaza LevelPL	
0	Judicial Building AJA (Not u	ısed)
	Judicial Building BJB	
ø	JailJ	
0	MagistrateM	
9	GarageG	

a ·		*
		*)
	a a	
		×
		Ø.
		74
¥		
		ž. V2
		1
		i .

## Police Headquarters

## 1. Architectural



Photo -HQ1



Photo -HQ2



Photo -HQ3

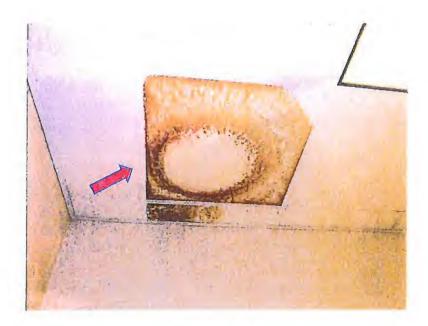


Photo -HQ4

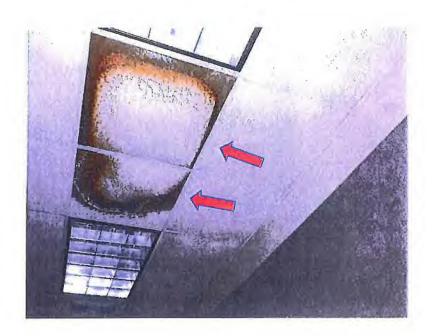


Photo -HQ5



Photo -HQ6

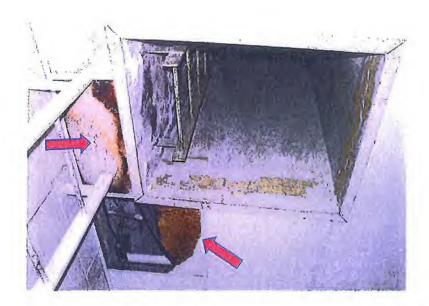


Photo -HQ7



Photo -HQ8



Photo -HQ9



Photo -HQ10



Photo -HQ11



Photo -HQ12



Photo -HQ13



Photo -HQ14

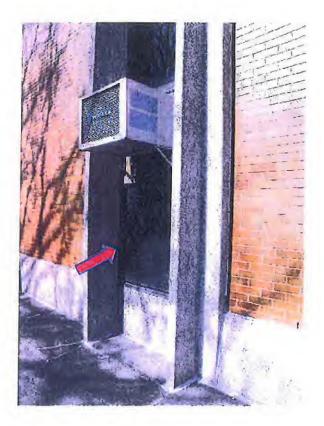


Photo -HQ15



Photo -HQ16



Photo -HQ17



Photo -HQ18

# <u>Plaza Level</u>

## 1. Architectural



Photo -PL1



Photo -PL2



Photo -PL3



Photo -PL4

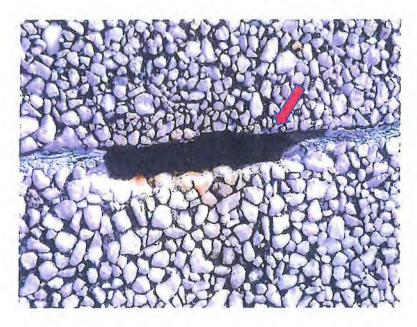


Photo -PL5

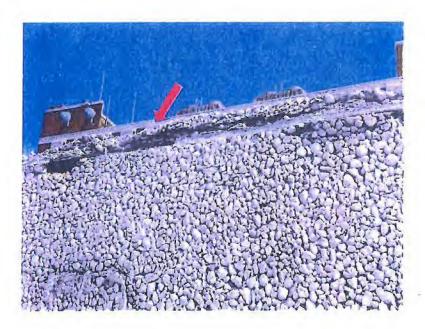


Photo -PL6

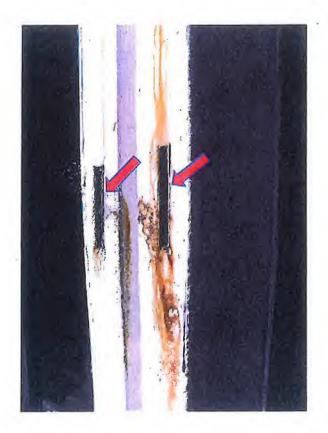


Photo -PL7



Photo -PL8



Photo -PL9



Photo -PL10

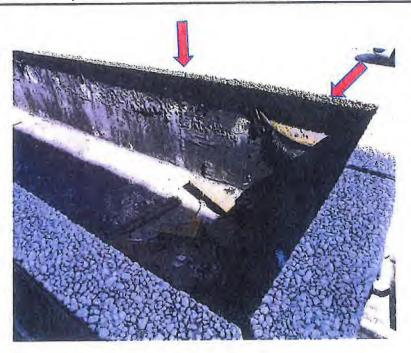


Photo -PL11



Photo -PL12



Photo -PL13



Photo -PL14



Photo -PL15

## **Judicial Building**

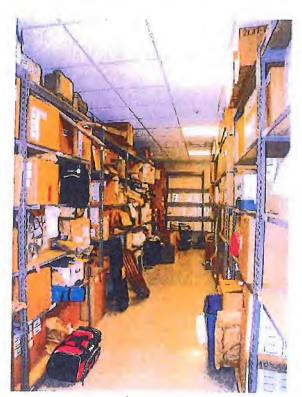


Photo -JB1



Photo -JB2



Photo -JB3



Photo -JB4

## <u>Jail</u>

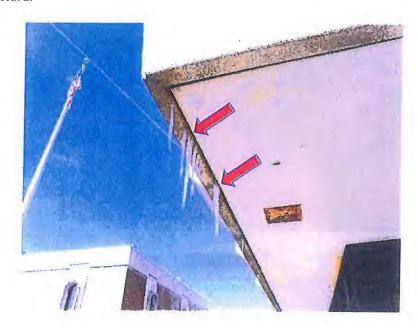


Photo -J1



Photo -J2



Photo -J3

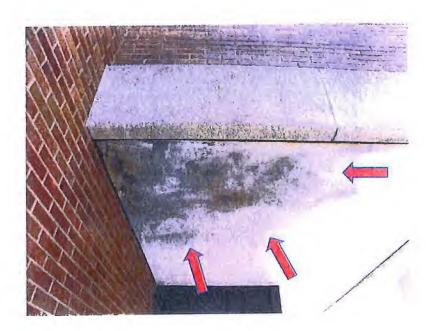


Photo -J4



Photo -J5

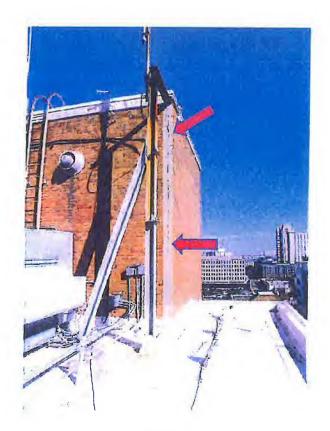


Photo -J6



Photo -J7

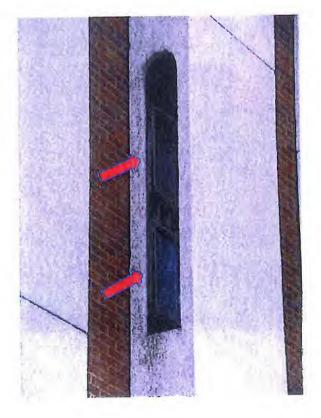


Photo -J8

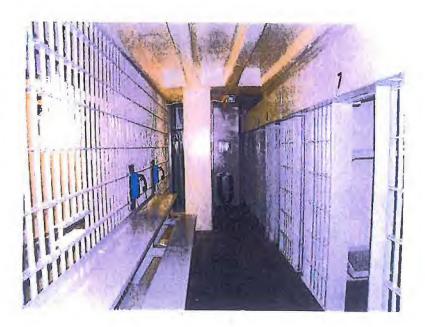


Photo -J9

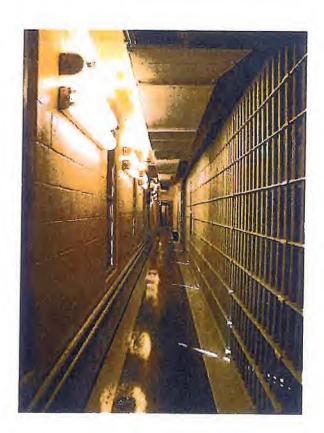


Photo -J10



Photo -J11

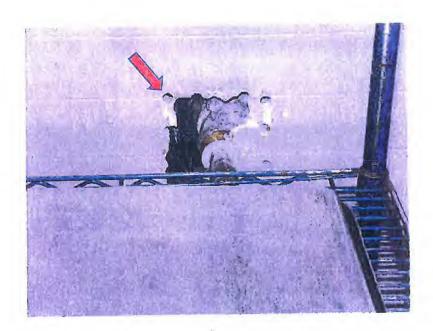


Photo -J12

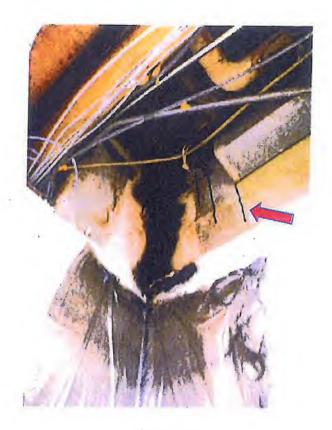


Photo -J13

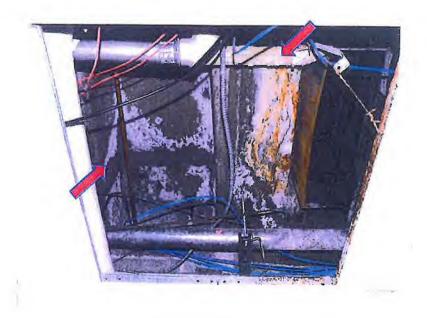


Photo -J14



Photo -J15

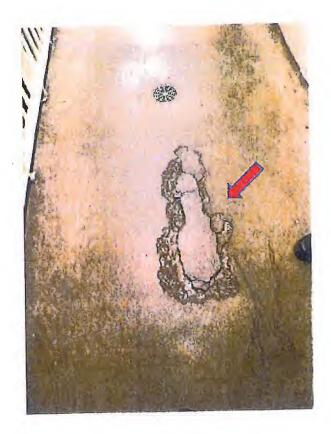


Photo -J16



Photo -J17



Photo -J18

## **Magistrate**



Photo -M1

## Garage



Photo -G1



Photo -G2

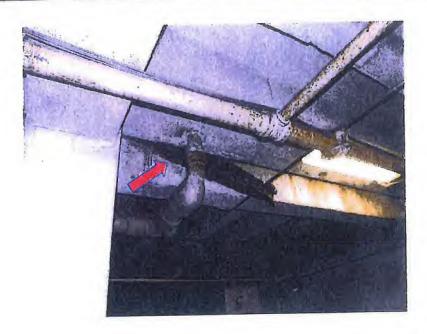


Photo -G3



Photo -G4



Photo -G5



Photo -G6

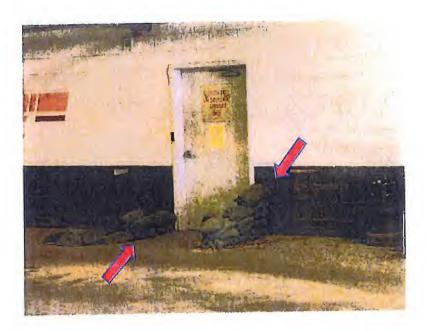


Photo -G7



Photo -G8



Photo -G9



Photo -G10



Photo -G11



Photo -G12



Photo -G13



Photo -G14



Photo -G15



Photo -G16



Photo -G17



Photo -G18

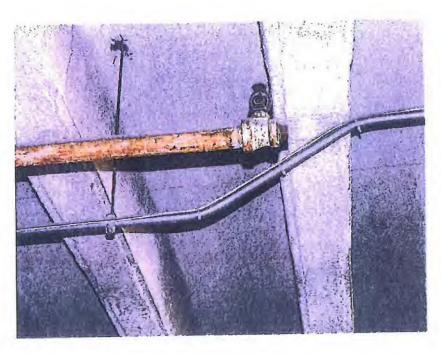


Photo -G19

## APPENDIX B – CONCEPT COST ESTIMATE

\* .

## Portsmouth Civic Center

**Condition Assessment Report** 

Portsmouth, Virginia

Attn: Danny Walker, AIA, DBIA - Principal

Clark Nexsen, Inc. Phone: 757.455.5800

DWalker@clarknexsen.com April 29, 2019 - REVISED

## SECTION 1 OVERVIEW

#### TABLE OF CONTENTS

Section 1:

Overview

Section 2:

Design Documents Log

Section 3:

Cost Estimate(s)

Section 4:

Qualifications & Clarifications

#### GENERAL PROJECT INFORMATION

Project Number: 19-0004

Project Name:

Condition Assessment Report

Owner:

Portsmouth, Virginia

Architect:

Clark Nexsen, Inc.

Address:

Portsmouth Civic Center

601 Crawford Street

Portsmouth, Virginia 23704

Parcel ID(s):

unknown

Jurisdiction(s):

City of Portsmouth

The City of Portsmouth has tasked Clark Nexsen with performing a partial condition assessment of the City's "OLD" Civic Center. Our scope is limited to Architectural and Fire Protection, as we understand the City of Portsmouth is contracting with other local design professionals and hazardous materials testing firms for the remainder of the facility assessment. The intent of this document is to document the existing conditions at each facility component, specifically, items requiring maintenance, repair or replacement. This will be used to assess funding requirements for repairs at these facilities and to guide in future decision making.

# SECTION 2 DESIGN DOCUMENTS LOG

The project design documents associated with this construction budget are listed as follows with dates based on when each was made available to Clark Nexsen Construction Services.

	proprietable residence and the second sections are second sections and the second sections are second sections as the second section sections are second sections as the second section sectio	the state of the s
Drawing Number	Description	Date
Multiple	Scans of Original Blueprints	08.20.1970

## SECTION 3 COST ESTIMATE

The preliminary budget was assembled based on the preliminary drawings provided by the Clark Nexsen design team and historical cost data. All costs and quantities listed herein are budgetary in nature. Below please find the summary values for each option. Please note that these costs contained herein do not contain FFE, and IT Installation. Detailed estimates are attached to the following sheets.

SUMMARY PRICING — Description	Value
Police Headquarters	\$5,436,764
Plaza Level	\$6,412,967
Judicial Building A	\$7,686,706
Judicial Building B	\$3,883,399
Jail	\$8,676,270
Magistrate	\$1,635,370
Garage	\$7,060,849

# SECTION 4

# QUALIFICATIONS & CLARIFICATIONS

This budget proposal maintains the following inclusions and exclusions which act as amendments to the project documents to clarify the intent of the construction budget.

# General Qualifications for All Estimates

- 1. Escalation We have assumed that the work is to be awarded in January 2021. As such, we have included an 12% annual construction cost escalation.
- 2. Design Fees We have included the design fees associated with this work as a fee of 10%.
- 3. Contingency We have included 20% contingency for this budget. This is consistent with the level of drawings and stage of the project. As the design and scope of work progresses, the contingency can be lowered accordingly.
- 4. Fees We have not included any permit fees, assessment fees or impact fees.
- 5. We assumed that all work was to be performed during normal working.
- It is assumed that any hazardous materials stored in this area will be removed by the Owner prior to start of construction.
- 7. Any special inspections are not included in this estimate.
- 8. Fixture Finishes and Equipment pricing is not included in this budget. This can be added upon further discussion with the project team as necessary.
  - a. Temporary requirements are included. These include temporary construction fencing and barricades, temporary construction signage for the building construction and signage for sitework and traffic control.
- We exclude temporary power and temporary water. These can be added to the budget if needed.
- 10. All Risk and Builders Risk Insurance to be provided by Owner. Deductibles for claims shall be by the Owner.
- 11. Payment and Performance Bonds are included.
- 12. CGL Insurance is included. It is assumed that the Builders Risk cots will be provided by The City via their current property insurance program.

## Division 02: Sitework and Demolition

- 1. Demolition of all interior spaces in the buildings is included.
- Minor demolition of the building's exterior façade is included.
- Removal of the plaza topping slab in included, including the waterproofing.
- 4. Removal of the existing decorative precast at the plaza perimeter and planters in included.
- Ground level sidewalks are removed.
- Installation of new planting soil and plants in the perimeter planters in included.

#### Division 03: Concrete

- Miscellaneous structural repairs and modifications are included for each space.
- Replacement of the Plaza topping slab in included.

- 3. Perimeter ground level sidewalks area included.
- 4. New precast concrete at the Plaza perimeter and planters is included.
- 5. A new 8" concrete slab-on-grade in included in the underground parking areas.

## Division 04: Masonry

- 1. New stair and elevator shafts are included.
- 2. Exterior masonry façade repairs and cleaning are included.

# Division 05: Structural and Miscellaneous Metals

- 1. Structural steel and metal deck modifications are included for each space.
- 2. Miscellaneous metals, stairs and railings are included.
- 3. Building expansion joints are included.
- 4. Judicial Building B included costs to repair collapsed / sagging floors.

## Division 06: Carpentry and Millwork

- 1. Rough carpentry and interior wood blocking are included.
- 2. Wood soffits are included for office and lobby areas.
- 3. Millwork / cabinets are included for restrooms and kitchens.

#### Division 07: Moisture & Thermal Protection

- 1. We include touching up the existing spray fireproofing.
- 2. Firestopping is included.
- 3. Interior and exterior caulking is included.
- 4. Replacement of the roofs is included.
- 5. Plaza and planter waterproofing is included.

#### Division 08: Windows & Doors

- 1. Hollow metal door frames are included with wood doors.
- 2. Aluminum windows and entrances are included.
- 3. Replacement of the jail tower windows is included.

#### Division 09: Interior Finishes

- 1. Metal stud framing and gypsum walls are included.
- 2. Porcelain tile is included for restroom areas.
- 3. Wood liner ceilings and epoxy terrazzo flooring are included for lobby areas.

#### Division 10: Specialties

- 1. Interior signage is included.
- 2. Folding partitions are included for conference rooms.
- 3. Toilet partitions and accessories are included.

4. Fire extinguishers and cabinets are included.

# Division 11: Equipment

1. We include parking control equipment at the garage entrances.

# Division 12: Furnishings

Roller shades and recessed entry mats are included.

## Division 13: Conveying Systems

1. Removal and replacement of the elevators is included.

# Division 13: Fire Protection

Excluded.

## Division 15: Plumbing

1. Excluded.

# Division 15: Mechanical HVAC

1. Excluded.

#### Division 16: Electrical

1. Excluded.

# Division 16: Telecommunications & Security

1. Excluded.

		* .
	ē	9 -

Project Number: 19-0004

Project Name:

Condition Assessment Report Portsmouth Civic Center Complex

Location:

Portsmouth, VA

April 25, 2019 - REVISED Estimate Date:

Area (SF):

240,883

Duration (WK):

# CLARKNEXSEN **Construction Services**

## **EXECUTIVE SUMMARY**

DESERIEMDM		inv	UNIE	DINIT PRICE	AMOUNT	625/1/sir	A SOLO PLANTING AND
CT COST SUMMARY			173		a trong a conj		the state of the
			- 1	a	\$303,821.00	\$1.26	rr s =
General Requirements	energies in electric district data			[6]	\$2,103,634.00	\$8.73	
Sitework & Demolition					\$2,751,009.00	\$11,42	
Concrete				1 44 44 4 7 4 7	\$1,515,717.00	\$6.29	+ 1 31 731 PROF - 1 TO ATE
Masonry Structural & Miscellaneo	a service of the serv		-		\$1,857,953.00	\$7.71	
and the second section of the second	IS 21661	) (IX	10	.   0 4   1	\$1,291,937.00	\$5.36	
Carpentry & Millwork					\$2,615,475.00	\$10.86	
Moisture & Thermal Prot	ection				\$2,791,282.00	\$11.59	
Windows & Doors		** * ** ***	. , ,		\$4,825,068.00	\$20.03	
Finishes			-		\$547,801.00	\$2.27	the transfer of the contract of
Specialties					\$25,000.00	\$0.10	p. no
Equipment			. 00	6	\$101,743.00	\$0.42	a splinger of the contract of
Furnishings			10 P 10 P		\$1,530,500.00	\$6,35	4
Conveying Systems					\$1,550,500.00	\$92.41	\$22,260,940.00
SUBTOTAL	rea at most distribute to the last an exercise			. (m ) v - to - )		232.41	
General Conditions	and the second state of the second se	30	MO	\$19,350.00	\$580,500.00		(4)
Construction Staffing - Se	e GC's	1	LS	\$0.00	\$0.00		
SUBTOTAL	Example of the term	+					\$22,841,440.00
							personal state of the state of
Contingency		20.0	%		\$4,568,288.00		
Escalation (12% Annual)	Section 1 may be seen	30	MO	\$228,414.00	\$6,852,420.00		
SUBTOTAL						7 A44 A41	\$34,262,148.00
		+					
Home Office Overhead		1.5	%		\$513,932.00		
SUBTOTAL						old of minimize	\$34,776,080.00
	n upman is surreprised in a	10.0	%		\$3,477,608.00	person our il	and the second second second second second second
Architectural & Engineer		5.0	%		\$1,738,804.00		
Construction Manageme	nt ree	5.0	10		31,730,004.00	The section blocks	\$39,992,492.00
SUBTOTAL					H 13 (198 W)	ne i a popular min	
Payment and Performant	ee Bond	1.0	%	1	\$399,925.00		
CGL & Builders Risk Insur	The second secon	1.0	%	14.00	\$399,925.00		
SUBTOTAL	Market and the Description of the Authority of the Control of the						\$40,792,342.00
The state of the s			/	10 00-1	10 1-0	24 (5935)	\$9(0,797.3A2.00)
ericial con		4.1156		The Late of the La	N. C. 14. 35	31132512	MANUSTRACIO

Project Number: 19-0004

Project Name:

Condition Assessment Report Portsmouth Civic Center Complex

Location: Estimate Date:

Portsmouth, VA April 25, 2019 - REVISED

Area (SF): Duration (WK): 240,883 129

CLARKNEXSEN **Construction Services** 

# **EXECUTIVE SUMMARY**

neschizitori.	OTY UNIT UNITERIOR	MANDANT	0051/8	TOTAL
E COST SUMMARY				
Police Headquarters (Two Stories at 14,000 SF Each)		- 000		E E E E E E E E
General Requirements	154	\$45,640.00		
Sitework & Demolition		\$241,063.00		
Concrete		\$56,000.00		The state of the s
Masonry		\$81,595.00		
Structural & Miscellaneous Steel	0	\$194,600.00		
Carpentry & Millwork		\$245,000.00		, ,
Moisture & Thermal Protection		\$457,800.00		
Windows & Doors	- 1	\$485,800.00		
Finishes		\$932,400.00		
Specialties		\$85,400.00		A.m.
Equipment		\$0.00		
Furnishings		\$29,400.00		1(3+3)
Conveying Systems		\$245,000.00		
SUBTOTAL		1- 1- 1	'	\$3,100,698.00
GC's, Contingency, Escalation, ETC.	75.34%	\$2,336,065.87	- 1	() (#4
TOTAL POLICE HEADQUARTERS		1 1 1 1 1	\$194.17	\$5,436,763.87
***		1		A 2 0 00 A 000
Plaza Level 142,972 SF Main Area with 4,378 SF Plante	Areal			
General Requirements		\$13,258.00	- 1	
Sitework & Demolition		\$535,941.00	- 1	
Concrete		\$1,457,353.00		
Masonry		\$0.00		
Structural & Miscellaneous Steel		\$210,708.00		•
Carpentry & Millwork		\$0.00		
Moisture & Thermal Protection		\$293,184.00		
Windows & Doors		\$0.00	. 1	
Finishes		\$0.00		
Specialties		\$143,243.00		
Equipment		\$0.00		
Furnishings		\$0.00		
Conveying Systems		\$0.00		Serven
SUBTOTAL		-1		\$4,989,752.87
GC's, Contingency, Escalation, ETC.	75.34%	\$3,759,279.81		

Judicial Building A (Two Stories at 20,310 SF Each)				
General Requirements		\$66,211.00		
Sitework & Demolition		\$348,328.00		
Concrete		\$81,240.00		
Masonry		\$116,291.00		
Structural & Miscellaneous Steel		\$282,309.00		
Carpentry & Millwork		\$355,425.00		
Moisture & Thermal Protection		\$664,137.00		
Windows & Doors		\$704,757.00		
Finishes		\$1,352,646.00		
Specialties	1100000	\$123,891.00		
Equipment		\$0.00		
Furnishings	The second of the second second second	\$42,651.00		the same of the sa
Conveying Systems		\$246,000.00		
SUBTOTAL	many and the second of the sec			\$4,383,886.00
GC's, Contingency, Escalation, ETC.	75.34%	\$3,302,819.71		
TOTAL JUDICIAL BUILDING A			\$189.23	\$7,686,705.71
TOTAL JODICIAL BOILDING A				
Judicial Building 8 (two Stories at 8,877 SF Each)				
General Requirements		\$28,939.00		
Sitework & Demolition		\$156,007.00		
Concrete		\$35,508.00		
with the same decision of the same state of the		\$56,471.00		
Masonry Structural & Miscellaneous Steel		\$389,700.00	1) (1) (1)	
The same of the sa	make a particular or on the contract of	\$155,347.00		
Carpentry & Milfwork		\$290,278.00		
Moisture & Thermal Protection		\$308,032.00		
Windows & Doors		\$591,209.00		
Finishes		\$54,149.00		
Specialties		\$0.00		
Equipment		\$18,642.00		
Furnishings		\$130,500.00		
Conveying Systems				\$2,214,782.00
SUBTOTAL	75.34%	\$1,668,616.76		
GC's, Contingency, Escalation, ETC.		1	\$218.73	\$3,883,398.76
TOTAL JUDICIAL BUILDING B				
or orange and class consists of C	670 SE Sach)			
Jall (Basement Area at 15.652 SF and Fight Stories at 5.	XIANI ERMI	\$99,568.00		
General Requirements		\$366,911.00		
Sitework & Demolition		\$122,168.00		
Concrete	where the same that the same state and	\$1,088,044.00		And the second of the second
Masonry		\$131,331.00		
Structural & Miscellaneous Steel		\$186,646.00		A AVER BY SHIP OF THE SE
Carpentry & Millwork		\$285,522.00		
Moisture & Thermal Protection		\$1,007,093.00		
Windows & Doors	THE P . MARKET MARKET AND ADDRESS OF THE PARK A	\$681,866.00		
Finishes		\$68,834.00		man of make dender conferences to
Specialties		\$00,834.00		
Equipment		\$2,272.00		
Furnishings		\$908,000.00		
Conveying Systems		\$900,000.00	1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	\$4,948,255.0
SUBTOTAL		\$3,728,015.32		1 141

(lagistrate (One Story at 8,360 SF)			
General Requirements	\$13,627.00		
Sitework & Demolition	\$69,004.00		
Concrete	\$15,720.00		make the diffuse se
Masonry	53,186,00	AL RESIDENCE AND A STREET	
Structural & Miscellaneous Steel	\$58,102.00	The second second second	es omnes seepally
Carpentry & Millwork	\$73,150.00		
Moisture & Thermal Protection	\$241,186.00		for the second solid at 100 to 100.
Windows & Doors	\$145,046.00		
Finishes	\$278,388.00		
Specialties	\$25,498.00		Ad read to Barry
Equipment	\$0.00		
Furnishings	\$8,778.00		
Conveying Systems	\$0,00		41 a-1 -1 -1 -1 -1 -1 -1 -1 -1 -1 -1 -1 -1 -
BTOTAL			\$932,685.
GC's, Contingency, Escalation, ETC. 75.	.34% \$702,684.88	1	
TAL MAGISTRATE  Tage [Parking Are at 53,480 SE and Office / Storage / Utility Are.	n at 31.586 SFI	\$195.62	\$1,635,369
TAL MAGISTRATE  Tage [Parking Are at 53,480 SF and Office / Storage / Utility Are;  General Regulrements	F 00 0-20 1 1 1-20 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	\$195.62	\$1,635,369.
TAL MAGISTRATE  Tage [Parking Are at 53,480 SF and Office / Storage / Utility Are;  General Regulrements  Sitework & Demolition	n at 31.586 SFI	\$195.62	\$1,635,369
TAL MAGISTRATE  Tage   Parking Are at 53,480 SF and Office / Storage / Utility Are;  General Regulrements  Sitework & Demolition  Concrete	a at 31,585 SF) \$36,578.00	\$195.62	\$1,635,369
TAL MAGISTRATE  Tage   Parking Are at 53,480 SF, and Office / Storage / Utility Are,  General Regulrements  Sitework & Demolition  Concrete  Masonry	sat 31,585 SF) \$36,578.00 \$386,380.00	\$195.62	\$1,635,369
TAL MAGISTRATE  Tage   Parking Are at 53,480 SF, and Office / Storage / Utility Are,  General Requirements  Sitework & Demolition  Concrete  Masonry  Structural & Miscellaneous Steel	\$36,578.00 \$36,380.00 \$982,020.00	\$195.62	\$1,635,369,
TAL MAGISTRATE  Tage   Parking Are at 53,480 SF, and Office / Storage / Utility Are,  General Requirements  Sitework & Demolition  Concrete  Masonry  Structural & Miscellaneous Steel  Carpentry & Millwork	\$36,578.00 \$36,380.00 \$982,020.00 \$170,130.00	\$195.62	\$1,635,369,
TAL MAGISTRATE  Tage   Parking Are at 53,480 SF, and Office / Storage / Utility Are,  General Requirements  Sitework & Demolition  Concrete  Masonry  Structural & Miscellaneous Steel  Carpentry & Millwork  Moisture & Thermal Protection	\$36,578.00 \$386,380.00 \$982,020.00 \$170,130.00 \$591,203.00 \$276,369.00 \$383,368.00	\$195.62	\$1,635,369,
TAL MAGISTRATE  Tage   Parking Are at 53,480 SF, and Office / Storage / Utility Are,  General Requirements  Sitework & Demolition  Concrete  Masonry  Structural & Miscellaneous Steel  Carpentry & Millwork  Moisture & Thermal Protection  Windows & Doors	\$36,578.00 \$386,380.00 \$982,020.00 \$170,130.00 \$591,203.00 \$276,369.00 \$383,368.00 \$140,554.00	\$195.62	\$1,635,369,
TAL MAGISTRATE  Tage   Parking Are at 53,480 SF, and Office / Storage / Utility Are,  General Requirements  Sitework & Demolition  Concrete  Masonry  Structural & Miscellaneous Steel  Carpentry & Millwork  Moisture & Thermal Protection  Windows & Doors  Finishes	\$36,578.00 \$386,380.00 \$386,380.00 \$982,020.00 \$170,130.00 \$591,203.00 \$276,369.00 \$383,368.00 \$140,554.00 \$988,559.00	\$195.62	\$1,635,369,
TAL MAGISTRATE  Tage   Parking Are at 53,480 SF, and Office / Storage / Utility Are,  General Requirements  Sitework & Demolition  Concrete  Masonry  Structural & Miscellaneous Steel  Carpentry & Millwork  Moisture & Thermal Protection  Windows & Doors  Finishes  Specialties	\$36,578.00 \$386,380.00 \$982,020.00 \$170,130.00 \$591,203.00 \$276,369.00 \$383,368.00 \$140,554.00 \$988,559.00 \$46,786.00	\$195.62	\$1,635,369,
TAL MAGISTRATE  General Requirements Sitework & Demolition Concrete Masonry Structural & Miscellaneous Steel Carpentry & Milwork Moisture & Thermal Protection Windows & Doors Finishes Specialties Equipment	\$36,578.00 \$386,380.00 \$982,020.00 \$170,130.00 \$591,203.00 \$276,369.00 \$383,368.00 \$140,554.00 \$988,559.00 \$46,786.00 \$25,000.00	\$195.62	\$1,635,369,
TAL MAGISTRATE  General Requirements Sitework & Demolition Concrete Masonry Structural & Miscellaneous Steel Carpentry & Millwork Moisture & Thermal Protection Windows & Doors Finishes Specialties Equipment Furnishings	\$36,578.00 \$386,380.00 \$982,020.00 \$170,130.00 \$591,203.00 \$276,369.00 \$383,368.00 \$140,554.00 \$988,559.00 \$46,786.00 \$25,000.00	\$195.62	\$1,635,369,
TAL MAGISTRATE  General Requirements Sitework & Demolition Concrete Masonry Structural & Miscellaneous Steel Carpentry & Millwork Moisture & Thermal Protection Windows & Doors Finishes Specialties Equipment Furnishings Conveying Systems	\$36,578.00 \$386,380.00 \$982,020.00 \$170,130.00 \$591,203.00 \$276,369.00 \$383,368.00 \$140,554.00 \$988,559.00 \$46,786.00 \$25,000.00	\$195.62	
TAL MAGISTRATE  General Requirements Sitework & Demolition Concrete Masonry Structural & Miscellaneous Steel Carpentry & Millwork Moisture & Thermal Protection Windows & Doors Finishes Specialties Equipment Furnishings Conveying Systems	\$36,578.00 \$366,380.00 \$982,020.00 \$170,130.00 \$591,203.00 \$276,369.00 \$140,554.00 \$988,559.00 \$46,786.00 \$0.00	\$195.62	\$4,026,947.0
TAL MAGISTRATE  General Requirements Sitework & Demolition Concrete Masonry Structural & Miscellaneous Steel Carpentry & Millwork Moisture & Thermal Protection Windows & Doors Finishes Specialties Equipment Furnishings Conveying Systems	\$36,578.00 \$366,380.00 \$982,020.00 \$170,130.00 \$591,203.00 \$276,369.00 \$140,554.00 \$988,559.00 \$46,786.00 \$25,000.00	\$195.62 \$195.62 \$83.01	

CLARKNEXSEN **Construction Services** 

Condition Assessment Report Portsmouth Civic Center Complex

Project Number: Project Name: Location: Estimate Date: Portsmouth, VA April 25, 2019 - REVISED

Area (SF): Duration (WK):

240,883 129

bestepnon	Shift Shift	480万美新疆	SUBMONITORS	1013	TOTAL GOST	suproje
entral Requirements	1. Miles	37.15.3	31116 5			\$202,0210
Service Control of the Control of th						
Police Headquarters				Na   m m - +++   +   +   + + + +		\$45,640.0
Temporary Elevator	28,000 SF	\$1.20	\$0.00		\$33,600.00	
BIM - LEEN	28,000 SF	\$0.20	\$0.00		\$5,600.00	
Building Envelope Consultant	28,000 SF	\$0.15	\$0.00		\$4,200.00	
and and an arrangement of the second of the	28,000 SF	\$0.08	\$0.00		\$2,240.00	
Temporary Fencing	10,000		- Charles			
	per service a resource to the	-				\$13,258.0
Plaza Level	47,350 SF	\$0.20	\$0.00	- A 7 7 1 114	\$9,470.00	a Cauda se
BIM - LEEN		10 10 manual 1	or or a management of		\$3,788.00	
Temporary Fencing	47,350 SF	\$0.08	\$0.00		75,750.00	
					1 to 1	\$66,211.0
Judicial Building A					1 - 1 - 1 - 1 - 1 - 1	300,211.1
Temporary Elevator	40,620 SF	\$1.20	\$0.00		\$48,744.00	
BIM - LEEN	40,620 SF	\$0.20	\$0.00		\$8,124.00	
Building Envelope Consultant	40,620 SF	\$0.15	\$0,00		\$6,093.00	
Temporary Fencing	40,620 SF	\$0.08	\$0.00		\$3,250.00	
remporary renents						
A DESCRIPTION OF THE PROPERTY OF THE PARTY O						\$28,939.
Ledicial Building B	17,754 SF	\$1.20	\$0.00		\$21,305.00	
Temporary Elevator		\$0.20	to the same to be a same to be		\$3,551.00	
BIM - LEEN	17,754 SF		50.00		\$2,663.00	A = 84 5
Building Envelope Consultant	17,754 SF	\$0.15	a me is the discount.		51,470,00	STAN SHOW I SHOW IN
Temporary Fencing	17,754 SF	\$0.08	50.00	065 m = 2000 1 - 100	21/410/00	
		-				\$99,568
Jail	of the tipe was			a de resta moras e a	45.71772	249,308
Temporary Elevator	61,084 SF	\$1.20	\$0,00		\$73,301.00	
BIM - LEEN	61,084 SF	\$0.20	\$0.00		\$12,217.00	
Building Envelope Consultant	61,084 SF	\$0.15	\$0.00		\$9,163.00	
Temporary Fencing	61,084 SF	\$0.08	50.00		\$4,887.00	
Temporary renema						
Administration	1 - 1 - 1 - 1 - 1					\$13,627.
Magistrate	B,360 SF	\$1.20	\$0.00		\$10,032.00	
Temporary Elevator		\$0.20	P P D SAME P		\$1,672.00	
BIM - LEEN	B,360 SF	\$0.15			\$1,254.00	
Building Envelope Consultant	8,360 SF	THE R. LEWIS CO., LANSING, MICH.	4 4 10 1 1 1 1 1 1 1 1 1 1		5669.00	
Temporary Fencing	8,360 SF	\$0.08	\$0.00		9003.00	at an install
						536,578.
Garage					412.015.00	220,278.
BIM - LEEN	85,065 SF	\$0.20	and the second sections	the same and the same of the s	\$17,013.00	
Building Envelope Consultant	85,065 SF	\$0.15		the common to the second of the common of th	512,760.00	
Temporary Fencing	85,065 SF	\$0.08	\$0.00		\$6,805.00	
and the second s	7 444					
THE THE PART OF TH	V 2011 - C 44 AME 1 100		)			
					The second second	1. 14105.04

19-0004

Project Number: Project Name:

Condition Assessment Report Portsmouth Civic Center Complex

Portsmouth, VA April 25, 2019 - REVISED Location: Estimate Date:

Area (SF): Duration (WK):

CLARKNEXSEN **Construction Services** 

FEE HIS TON	no unit	ग्रेसा स्त्राहरू	Steamhunter	hoisi	TOTAL MEMOR
even k danaktor				Index Line	\$403,690
Police Headouarters			1 4 1 4	9.5	THE PERSON NAMED IN COLUMN TWO IS NOT THE OWNER, THE PERSON NAMED IN COLUMN TWO IS NOT THE OWNER, THE PERSON NAMED IN COLUMN TWO IS NOT THE OWNER, THE PERSON NAMED IN COLUMN TWO IS NOT THE OWNER, TH
Demolish Building Interior	20,000 55	* ***	- 133 La		\$241,063.0
Selective Exterior Skin Demolition	28,000 SF	\$8.00	\$0.00		5224,000.00
	17,063 SF	\$1.00	\$0.00		\$17,063.00
Abatement and Remediation by Others		\$8.00	\$0.00		\$0.00
Plaza Level				1 -	\$535,941.0
Demolish Plaza Area	42,972 SF	\$8.00	\$0.00		\$343,776.00
Remove Waterproofing	42,972 SF	\$1.00	\$0.00	+	\$42,972.00
Remove Precast Planter Walls	2,753 SF	55,00	\$0.00		\$13,763.00
Remove Precast Walls	11,730 SF	\$5.00	\$0.00		1 AA PR A 194 -
Remove Sidewalks	16,500 SF	\$2.00	5 000		\$58,650,00
For an an	10,300 31	\$2,00	\$0.00		\$33,000.00
New Planter Solls and Plants	4,378 SF	\$10.00	\$0.00		\$43,780.00
					The second secon
Ludicial Building A					\$348,328.00
Demolish Building Interior	40,620 SF	\$8,00	50.00	-0	\$324,960.00
Selective Exterior Skin Demolition	23,368 SF	\$1.00	50.00		\$23,368,00
Abatement and Remediation by Others	#5,516	\$0.00	\$0.00	-	e les waves life in
A Shire Sh. Sh. Same And Mills and Address Address and		7			\$0,00
Indicial Building B					\$156,007.00
Demolish Building Interior	17,754 SF	\$8.00	50.00		\$142,032.00
Selective Exterior Skin Demolition	13,975 SF	\$1.00	\$0.00		The France of the
Abatement and Remediation by Others		\$0.00	\$0.00		\$13,975.00
restantiant of other		30,00	30.00		\$0.00
Lali			1		7527551
Demolish Bullding Interior	21,331 SF	60.00	70.00	4-17-014-7-7-7	\$366,911.00
Demolish Bullding Interior		\$8.00	\$0.00	Basement and Ground Floor	\$170,648.00
	39,753 SF	\$4.00	50.00	Tower	\$159,012.00
Selective Exterior Skin Demolition	37,251 SF	\$1.00	\$0.00	:	\$37,251.00
Abatement and Remediation by Others	-	\$0,00	\$0.00		\$0.00
Magistrate	line to the	4			\$69,004.00
Demolish Bullding Interior	e sen ec	\$8.00	\$0.00		THE PERSON NAMED IN CO. P. LEWIS CO. P. LEWIS CO., LANSING, MICH. 49, 187 P. LEWIS CO
Selective Exterior Skin Demolition	8,360 SF 2,124 SF	T-1000000000000000000000000000000000000			\$66,880.00
	2,124 35	\$1.00	\$0.00	4 11 4 7	\$2,124.00
Abatement and Remediation by Others		\$0.00	50.00	restant to - S	\$0,00
Garage		- 1 n	11 61 6		\$365 200 DO
Demolish Building Interior	31,585 5#	\$8.00	\$0.00		\$386,380.00 \$252,680.00
Remove Existing Parking Floor	53,480 SF	\$2,50	\$0.00	7 50 7 0 44 1	\$133,700.00
Abatement and Remediation by Others	,	\$0.00	\$0.00		
CONTROL OF THE PERSON OF CALLETS	2	20,00	\$0.00	in the second	\$0.00
A W W WARREN OF MA				1 1 1 1 1 1	Util to a real end or
		The state of the same			
i syra allantis, o remigraficação i		30 marks	1		their side shoulding

19-0004

Condition Assessment Report Portsmouth Civic Center Complex

Project Number: Project Name: Location:

Portsmouth, VA April 25, 2019 - REVISED Estimate Date:

Area (SF): Duration (WK): 240,883 129

# CLARKNEXSEN Construction Services

RESCHOOL	THE VIET	中的特別的	STREET STREET	la C.	ROTEY	ं सिल् सेवी	2010/01/01
phote		14	LE LONG		PERMIT	A Company	\$2,751,009.00
			⇒) = + + + (+				\$56,000.00
Police Headquarters Structural Repairs and Modifications	28,000 SF	\$2.00	\$0.00			\$56,000.00	
The second secon			n l		( )		\$1,457,353.0
Plaza Level Structural Repairs and Modifications	47,350 SF	\$2,00	\$9.00			\$94,700.00	
Plaza Slab Replacement	42,972 SF	\$7.50	\$0.00	e 4		\$327,290.00	
Sidewalk Repairs and Replacement	16,500 5F	\$6.00	50,00	4.1		\$59,000.00	Live .
Precast Planter Walls	2,753 SF 11,730 SF	\$65.00 \$65.00	\$0.00			\$762,450.00	x = 0 1 +
Precast Walls	11,730 5	703.00					
Judicial Building A	Charles and				41 4 4		581,240.
Structural Repairs and Modifications	40,620 SF	\$2.00	\$0.00		v ~ *	581,240.00	49 v 100 - 4 Vin
Indicial Building B				4 4 10		and to the fermi	\$35,508.
Structural Repairs and Modifications	17,754 SF	52,00	50.00	4 +		\$35,508.00	
A STATE OF THE STA					. 1000 - 0 1	t p the a tr	\$122,168
Structural Repairs and Modifications	61,084 SF	\$2.00	\$0.00	11 1	1 1 1 1	\$122,168.00	the same of the same of the same of
Structural Repairs and Modifications							****
Magistrate						\$16,720.00	\$16,720,
Structural Repairs and Modifications	8,360 SF	\$2.00	\$0,00	A		920,700.00	
Garage							5982,020
Structural Repairs and Modifications	85,065 SF	\$4.00	\$0.00			\$340,260.00	
8" Slab on Grade	53,480 SF	\$12.00	\$0,00		11 30 10 1	3541,700.00	THE PERSON NAMED IN
			AND DOCUMENT	-		erepakti i	A ANTON THE
and course in	by A - De-la				Committee of the Land	57-79110000	1 31.151,019.

Project Number:

19-0004

Condition Assessment Report Portsmouth Civic Center Complex

Project Name: Location: Estimate Date: Portsmouth, VA April 25, 2019 - REVISED

Area (SF): 240,883 Duration (WK): 129

CLARKNEXSEN **Construction Services** 

(Peyelithal).	OR ON	With the Substitution	Hores	Totaccost Statos
history			- e H	\$1/5152020
Police Headquarters CMU Stair and Elevator Shafts Exterior Masonry Repairs and Cleaning	28,000 SF 17,063 SF	\$2.00 \$0.00 \$1.50 \$0.00	0- 1	\$81,595.0 \$56,000.00 \$25,595.00
Plaza Level None		\$0.00 50.00		\$0.00
<u>Judicial Building A</u> CMU Stair and Elevator Shafts Exterior Masonry Repairs and Cleaning	40,620 SF 23,368 SF	\$2.00 \$0.00 \$1.50 \$0.00		\$116,291.6 \$81,240.00 \$35,051.00
<u>Indicial Building R</u> CMU Stair and Elevator Shafts Exterior Masonry Repairs and Cleaning	17,754 SF 13,975 SF	\$2.00 \$0.00 \$1.50 \$0.00		\$56,471.6 \$35,508.00 \$20,963.00
CMU Stair and Elevator Shafts Exterior Masonry Repairs and Cleaning Remove and Replace Tower Windows	61,084 SF 37,251 SF 182 EA	\$2.00 \$0.00 \$1.50 \$0.00 \$5,000.00 \$0.00	0.1	\$1,088,044.0 \$122,168.00 \$55,876.00 \$910,000.00
Magistrate Exterior Masonry Repairs and Cleaning	2,174 SF	\$1.50 \$0.00		\$3,186.00 \$3,186.00
Garage CMU Stair and Elevator Shafts	85,065 SF	\$2.00 \$0.00		\$170,130.00 \$170,130.00
ry, Masoniu	Marie Laure	Total Adams and	Name and Address of the Owner, where	Statzenie Statzenie

Project Number: Project Name:

19-0004 Condition Assessment Report Portsmouth Civic Center Complex Portsmouth, VA April 25, 2019 - REVISED

Location: Estimate Date:

Area (SF): Duration (WK): 240,883 129

# CLARKNEXSEN Construction Services

08480100	THE WAY	Dan Pales 3/180	NO MET	/1613	Total Cost (1000)
musional Economical Steph		Company of Property			\$1,357,950
Do Million to the control of the control of the control of					\$194,600.
Police Headquarters		\$2.50	\$0.00		\$70,000.00
Structural / Deck Modifications	28,000 SF	to street a comment	\$0.00		\$56,000,00
Misc Metals (Stairs / Ladders / Angles)	28,000 SF	\$2,00 \$2,30	\$0.00		\$64,400.00
Stair / Glass Handrails	28,000 SF	THE RESIDENCE OF THE PERSON OF	Amenda also see a		\$4,200.00
Expansion Joints	28,000 SF	\$0.15	\$0.00		
Plaza Level	P + 1 + 1	(+ ()-			5210,70B
Misc Metals (Stairs / Ladders / Angles)	47,350 SF	\$2.00	50.00		\$94,700.00
All Al	47,350 SF	\$2,30	\$0,00		\$108,905.00
Stair / Glass Handralls	47,350 SF	\$0.15	\$0.00		\$7,103.00
Expansion Joints	-117.11.1				
Judiclat Building A					\$282,309
Structural / Deck Modifications	40,620 SF	\$2.50	50,00		\$101,550.00
Misc Metals (Stairs / Ladders / Angles)	40,620 SF	\$2.00	50.00		\$81,240.00
Stair / Glass Handralls	40,620 SF	\$2.30	50.00	*****	\$93,426.00
Expansion Joints	40,620 SF	\$0.15	\$0.00		\$6,093.00
Expension of the				Ann the second	
Judicial Building B					\$389,700
Structural / Deck Modifications	17,754 SF	\$2.50	\$0.00		\$44,385.00
Misc Metals (Stairs / Ladders / Angles)	17,754 SF	\$2.00	\$0,00		\$35,508.00
Stair / Glass Handralls	17,754 SF	\$2,30	\$0.00		\$40,834.00
Expansion Joints	17,754 SF	\$0.15	\$0.00		57,663.00
Rebuild Collapsed / Sagging Floors	8,877 57	\$30.00	\$0.00	h	\$766,310.00
Historica could be and Care of the Care of					
ial					\$131,331
Misc Metals (Stairs / Ladders / Angles)	61,084 SF	\$2.00	\$0.00	11 2	\$122,168.00
Expansion Joints	61,084 SF	\$0.15	\$0.00		\$9,163.00
LANDRIAGO SOUTH					V 1 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2
Magistrate					558,102
Structural / Deck Modifications	8,360 SF	\$2.50	\$0.00		\$20,900.00
Misc Metals (Stairs / Ladders / Angles)	8,360 SF	\$2.00	50.00		\$16,720.00
Stair / Glass Handralls	8,360 SF	\$2.30	\$0.00	and the second of	\$19,228.00
Expansion Joints	8,360 SF	\$0.15	\$0.00		\$1,254.00
LAPATINITION TO THE PART OF TH	.,			a transfer of the second	
Garage					\$591,203
Structural / Deck Modifications	85,065 SF	\$2.50	\$0.00		\$212,663.00
Misc Metals (Stairs / Ladders / Angles)	85,065 SF	\$2.00	\$0,00		\$170,130.00
Stair / Glass Handrails	85,065 SF	\$2.30	\$0,00		\$195,650.00
Expansion Joints	85,065 SF	50.15	\$0.00	4 1 2 years   and 1010 1010	\$12,760.00
				war ways warmen	
				and the second s	manufactured in the second
ofia Kinge (1980) is fluxed (2005) grant	1000	12 Page 1			51,657,051,00 11,657,05

19-0004

Condition Assessment Report Portsmouth Civic Center Complex Portsmouth, VA April 25, 2019 - REVISED

Project Number: Project Name: Location: Estimate Date:

Area (SF); Duration (WK):

240,883

## CLARKNEXSEN **Construction Services**

a shemiraphi	1000 1000	Unit value	Street Hittoria	500G	KOMA GOST	spaint.
ingentry & Millionia	310					Si Pilalia
Police Headquarters			A 11-1		- 1	\$245,000.0
Rough Carpentry	28,000 SF	\$1.45	\$0.00		\$40,600.00	11-11-1
Wood Soffit	28,000 SF	\$3.00	50.00		\$84,000.00	
Millwork	28,000 SF	\$4,00	50.00		\$112,000.00	
Interior Wood Blocking	28,000 SF	\$0.30	\$0.00		\$8,400.00	-
	C	. 6225	X-1(2.1)	8-7 1 - 1 3	10,1111	
Plaza Level						\$0.0
None	.,,	\$0.00	\$0.00		\$0.00	
	18	1 the	411 441			-
A solution A			06			\$355,425,0
Rough Carpentry	40,620 SF	\$1.45	\$6,00		\$58,899.00	1-11
Wood Soffit	40,620 SF	53.00	50.00		\$121,860,00	
Millwork	40,620 SF	\$4.00	\$0.00		5162,480,00	
Interior Wood Blocking	40,620 SF	\$0.30	\$0.00		\$12,186.00	
						4 % 4
Indicial Buildion B	1					\$155,347.0
Rough Carpentry	17,754 SF	\$1.45	\$0.00		\$25,743.00	
Wood Soffit	17,754 SF	\$3.00	\$0.00		\$53,262,00	THE REAL PROPERTY.
Millwork	17,754 SF	\$4.00	50.00		\$71,016.00	
Interior Wood Blocking	17,754 SF	50.30	\$0.00	- 4	\$5,326,00	
V - Manual Committee and Commi		- VA.1			- minerin	170
Lall	-	-				\$186,646.0
Rough Carpentry	21,331 SF	\$1.45	\$0,00	Basement and Ground Floor	\$30,930.00	Tarasa N
Wood Soffit	21,331 SF	\$3.00	\$0,00	Basement and Ground Floor	\$63,993.00	
Millwork	21,331 SF	\$4.00	\$0,00	Basement and Ground Floor	\$85,324.00	
Interior Wood Blocking	21,331 SF	50.30	\$0.00	Basement and Ground Floor	\$6,399.00	
		-			- 101	
Magistrate	10.		4 4 4-			\$73,150.0
Rough Carpentry	8,360 SF	\$1.45	\$0.00		\$12,122.00	- 1 - 10
Wood Soffit	B,360 SF	\$3.00	\$0.00	AL.	\$25,080.00	
Millwork	8,360 SF	\$4.00	\$0.00		\$33,440.00	
Interior Wood Blocking	8,360 SF	\$0.30	\$0.00		\$2,508.00	
		-,2- (1		***		
Garage						\$276,369.00
Rough Carpentry	31,585 5F	\$1.45	50.00	Office and Storage	\$45,798.00	and the same of the
Wood Soffit	31,585 SF	\$3.00	50.00	Office and Storage	\$94,755.00	-1
Millwork	31,585 SF	\$4.00	\$0.00	Office and Storage	\$126,340.00	
Interior Wood Blocking	31,585 SF	50.30	\$0.00	Office and Storage	\$9,476.00	
					and the second second second	
		-1		*		
trackgristere is alm words	- Laboure Laboratory			110	dr. kit alkin	a kidd tarir in

CLARKNEXSEN
Construction Services

Project Number:

19-0004

Project Name:

Condition Assessment Report Portsmouth Civic Center Complex

Location: Portsmouth, VA
Estimate Date: April 25, 2019 - REVISED

Area (SF): Duration (WK):

240,883 n (WK): 129

DESCRIPTION S. L.	An Carrie	- HATE PHOES	THISTONHAND	20048	1	With the state	a delaton
ostina & Thermal Posterillon	11 1 2020		151, 151, 153, 153, 163, 163, 163, 163, 163, 163, 163, 16	The same and	E H U		STATISTICS.
ORTHO S. Incommercialization							
the sales of the s			2 1 - 1 1				\$457,800.
Police Headquarters	28,000 SF	\$1.50	\$0.00			\$42,000.00	term .
Spray Fireproofing Touchup	28,000 SF	\$1.40	\$0.00	- 4 + 4 - 1 - 1		\$39,200.00	
Firestopping	28,000 5F	\$0.60	\$0.00		,	\$16,800.00	
Caulking and Sealants - Exterior	28,000 SF	\$0.35	\$0,00			\$9,800.00	
Caulking and Sealants - Interior		\$25.00	\$0.00			\$350,000.00	
Remove and Replace Roof	14,000 SF	\$25,00					
The second secon			6 m) n				\$293,184
Plaza Level			1 1		** 4 ** **	\$28,410.00	plant like
Caulking and Sealants - Exterior	47,350 SF	\$0,60	50,00		H109	\$214,860.00	
Plaza Waterproofing	42,972 SF	\$5.00	\$0.00			\$49,914.00	*****
Planter Waterproofing	7,131 SF	\$7.00	\$0.00			349,914,00	
to the could be maked, a smaller but he profession with a first transfer of the profession of the prof					( July 10		\$664,137
Judicial Building A	13.00			1 1 0 m 1 1 1 1 1 1 1 1 1			3664,137
	40,620 SF	\$1.50	\$0.00			\$60,930.00	
Spray Fireproofing Touchup	40,620 SF	\$1.40	\$0.00			\$56,868.00	
Firestopping	40,620 SF	\$0,60	\$0.00			\$24,372.00	
Caulking and Sealants - Exterior	40,620 SF	\$0,35	50.00			\$14,217.00	
Caulking and Sealants - Interlor	20,310 SF	\$25.00	\$0.00			\$507,750.00	
Remove and Replace Roof	20,510 ac		. 7.000				
				.6	4 .		\$290,270
Judicial Building B		\$1.50	50.00		minima a	\$26,631.00	
Spray Fireproofing Touchup	17,754 SF		manufacture of the same of the	AND AND PURCOUNTY		\$24,856.00	
Firestopping	17,754 SF	\$1.40	- The manufacture			\$10,652.00	
Caulking and Sealants - Exterior	17,754 SF	\$0.60		and but I'll to the		\$6,214.00	
Caulking and Sealants - Interior	17,754 SF	\$0,35	\$0.00	MARKET SELECTION AND ADDRESS.		\$221,925.00	
Remove and Replace Roof	8,877 SF	\$25.00	\$0.00		- 41	3221,323.00	
to the same of the					-		5285,522
lati					1 27 97		
The second secon	61,084 SF	\$1.40	\$0.00	2		\$65,518.00	
Firestopping	61,084 SF	\$0.60	\$0.00	2		\$36,650.00	
Caulking and Sealants - Exterior	61,084 SF	\$0.35	\$0.0		10 - 10	\$21,379.00	4 7.0
Caulking and Sealants - Interior	5,679 SF	\$25.00	\$0.00			\$141,975.00	) 
Remove and Replace Roof		40 1 1 9 9 10	,				
the second section of the second section is the second section of				a great action .			\$241,18
Magistrate	8,360 SF	\$1.50	\$0.0	0		\$12,540.DE	
Spray Fireproofing Touchup	8,360 SF	\$1.40		market and the same of the	1 F. 10 by P.	\$11,704.00	3
Firestopping		\$0.60	and the same of th	A CONTRACTOR OF THE PARTY OF TH		\$5,016.0	3
Caulking and Sealants - Exterior	8,360 SF	\$0.35	A	the market by paying a		52,926.0	
Caulking and Sealants - Interior	8,360 SF	No		and the of states of the contract of		\$209,000.0	managed to the second
Remove and Replace Roof	8,360 SF	\$25.00	\$0.0		-		
						20 c c 2 c - 4 c -	\$383,36
Garage						\$119,091.0	and the same of the same of
Firestopping	85,065 SF	\$1.4		the state of the s		HERE THE PERSON NAMED IN	
Caulking and Sealants - Interior	85,065 SF	\$0,3	the Parameter of Address.	make the state of		\$29,773.0	
Perimeter Wall Waterproofing Repairs	39,084 SF	\$6.0	\$0,0	0		\$234,504.0	0
Letillieret Akoli Akori bi populit jedana							
many control or the control of the c							
and the contraction of the state of the stat	minus						
errom superiore de deposito. Productivida	CAPACION CO.	THE REAL PROPERTY.	STREET, SQUARE	MINISTER OF THE PARTY OF THE PA	2000	34.519/1633	4 50.55万世

Project Number:

19-0004

Condition Assessment Report Portsmouth Civic Center Complex

Project Name: Portsmouth, VA April 25, 2019 - REVISED Location:

Estimate Date:

240,883 129 Area (SF): Duration (WK):

CLARKNEXSEN **Construction Services** 

DESCRIPTION	200 (10)	<b>建一种工作</b> 1000	वर्गा होते हो। इ.स.च्या	Sofies	TOTALLED SUPPOY
Mindows & Ijones		Section 5			\$2(2)(332)
					Sept.
Police Headquarters				1 0-	\$485,800.0
HM Doors and Frames	28,000 SF	\$2.40	\$0.00		\$67,200.00
Wood Doors	28,000 SF	\$0.90	50,00		\$25,200.00
Access Doors	28,000 SF	\$0.15	50,00		\$4,200.00
Coiling Doors and Shutters	28,000 SF	\$0.10	50.00	-	THE R SEPARATE OF A P.
Aluminum Windows and Entrances	28,000 SF	\$13.80	50.00		\$2,800.00
-1	that a man are a	¥13.60	50.00		\$386,400.00
Plaza Level				f	
None		to 00			\$0.00
10010	1.2.14	\$0.00	\$0.00		\$0.00
Judicial Building A		F 40.			
HM Doors and Frames	4774 47	7-4			5704,757.00
THE PERSON NAMED IN COLUMN TWO IS NOT THE PERSON NAMED IN COLUMN TWO IS NAM	40,620 SF	\$2.40	\$0.00		\$97,488,00
Wood Doors	40,620 SF	\$0.90	\$0,00		\$36,558.00
Access Doors	40,620 SF	\$0.15	50.00		\$6,093.00
Coiling Doors and Shutters	40,620 SF	\$0.10	50,00		\$4,062.00
Aluminum Windows and Entrances	40,620 SF	\$13.80	\$0.00		5560,556.00
District Control of the Control of t					1 1 100 1212 1
Judicial Buildine B	A *** * * *				\$308,032.00
HM Doors and Frames	17,754 SF	\$2.40	\$0.00		\$42,610.00
Wood Doors	17,754 SF	\$0.90	50.00		\$15,979.00
Access Doors	17,754 SF	\$0,15	\$0,00		\$2,663,00
Colling Doors and Shutters	17,754 SF	50.10	\$0.00	- 14	\$1,775.00
Aluminum Windows and Entrances	17,754 SF	\$13,80	50,00		\$245,005.00
			12.35		A CAMP FOR THE PARTY OF THE PAR
jal .			-		54 007 007 DB
HM Doors and Frames	21,331 SF	\$2,40	50.00	Basement and Ground Floor	\$1,007,093.00
Wood Doors	21,331 SF	\$0.90	50.00	Basement and Ground Floor	\$51,194.00
Access Doors	21,331 SF	\$0.15	\$0.00	A THE R. LEWIS CO., LANSING, MICH. 49, 1971.	519,198.00
Coiling Doors and Shutters	and the second second	A MARKET DE LOS ALLES		Basement and Ground Floor	\$3,200.00
	Prince - Name	\$0,10	\$0.00	Basement and Ground Floor	\$2,133.00
Aluminum Windows and Entrances	21,331 SF	\$13.80	50.00	Basement and Ground Floor	5294,368.00
Remove and Replace Tower Windows	182 EA	\$3,500.00	\$0.00		\$637,000.00
Manufactura	22.1				
Magistrate	P 244 was 244				\$145,046,00
HM Doors and Frames	B,360 SF	\$2.40	50.00		\$20,064.00
Wood Doors	8,360 SF	\$0.90	\$0.00		\$7,524.00
Access Doors	8,360 SF	\$0.15	\$0.00		\$1,254.00
Coiling Doors and Shutters	8,360 SF	\$0.10	50.00		\$836,00
Aluminum Windows and Entrances	8,360 SF	\$13.80	\$0.00		THE PROPERTY AND PERSONS NAMED IN COLUMN 2
	. 144 1	7			\$115,368.00
Garage					745 7 774 774
HM Doors and Frames	31,585 SF	\$2,40	\$0.00	04	5140,554.00
Wood Doors	31,585 SF	\$0.90	\$0.00	Office and Storage	\$75,804.00
Access Doors	31,585 SF	\$0.90	deducts die	Office and Storage	\$28,427.00
	STREET STREET STREET	The State of	\$0.00	Office and Storage	\$4,738.00
Colling Doors and Shutters	31,585 SF	\$1.00	\$0.00	Office and Storage	\$31,585.00
received the second control of the second		Clark many a	-		
THE R. P. LEWIS CO., LANSING MANAGEMENT AND ADDRESS OF THE PARTY AND PARTY A					
As singularies & tightes.			100	THE RESERVE OF THE PARTY OF THE	34380.484300 (\$4794.812.00)

CLARKNEXSEN **Construction Services** 

Project Number: Project Name:

19-0004

Condition Assessment Report Portsmouth Civic Center Complex Portsmouth, VA April 25, 2019 - REVISED

Location: Estimate Date:

Area (SF): Duration (WK):

<b>可知知的</b> 证例		(0)19 /0/6	112	DOMESTICS	all experiences	A CONTRACTOR OF THE PARTY OF TH	3000000000	1000
melrius		Post I		14g. et 12.	151.5	pergraph of the dayship	10	1825,059
03/10-2/-				-				77-77-1
Police Headquarters			-		**** * * ***	the transfer of the course of the		\$932,40
the same the same discussion and the same of the same	1 1 1 1 1 1	28,000 SF		\$14.15	\$0.00	AT	\$396,200.00	4000
Metal Framing / GWB					the second of the owner, where			
Porcelain Tile		28,000 SF	4 40	\$2.25	\$0.00		\$63,000.00	
Wood Liner Ceiling	+ 10 1	28,000 SF		\$4,50	\$0.00		\$126,000.00	11
ACT Ceiling	The state of the s	28,000 SF		\$3.50	\$0.00		\$98,000,00	11 0 11
LVT / Carpet		28,000 SF		\$4.80	\$0.00		\$134,400.00	
Epoxy Terrazzo Flooring		28,000 SF		\$1.40	\$0.00		\$39,200.00	
Acoustical Wall Panels	1 11 11 11 11	28,000 SF	-	\$0.25	\$0.00		\$7,000.00	
		28,000 SF	-	\$2.45	\$0.00	M	\$68,500.00	
Painting		20,000 31	- 1	. 71.22	1. 1.4		M-25 W	
All property of the self-section in		2 6 4 4 4 4		90 A NO. O A N	sale in the first	4		
Plaza Level	2 A			on an alternation		-1 11	1 - 1 - 1 - 1	-
None		- 4 - 4		\$0.00	\$0.00	a a the discount of	\$0.00	
								-
Judicial Building A								51,352,6
Metal Framing / GWB		40,620 SF		\$14.15	\$0.00		\$574,773.00	
Porcelain Tile		40,620 SF		\$2.25	\$0.00		\$91,395.00	
Wood Liner Ceiling	** * * * * * * * * * * * * * * * * * * *	40,620 SF		\$4.50	\$0.00		\$182,790.00	
		40,620 SF	- 1	\$3.50	\$0,00		\$142,170.00	1 4 - 2
ACT Ceiling			-	\$4.80	\$0.00		\$194,976.00	
LVT / Carpet		40,620 SF						j. 1 - 10,4 -
Epoxy Terrazzo Flooring		40,620 SF		\$1.40	\$0.00		\$56,868.00	
Acoustical Wali Panels		40,620 SF		\$0.25	\$0.00		\$10,155.00	
Painting		40,620 SF		\$2.45	\$0.00		\$99,519.00	
1								
Judicial Building B								\$591,2
		17,754 SF		\$14.15	\$0.00		\$251,219.00	armedia medica
Metal Framing / GWB	*** * **** * ****	17,754 SF		52,25	50.00		\$39,947.00	0.0 44 0
Porcelain Tile			-	54,50			\$79,893.00	
Wood Liner Celling		17,754 SF			\$0.00			200 H &
ACT Celling		17,754 SF		\$3,50	50.00	PP - 1 41 - 1 - 1	\$62,139.00	100
LVT / Carpet		17,754 SF	-	\$4,80	50.00		\$85,219.00	
Epoxy Terrazzo Flooring		17,754 SF		\$1.40	\$0.00		\$24,856.00	
Acoustical Wall Panels		17,754 SF		\$0.25	\$0.00		\$4,439.00	
Painting		17,754 SF		\$2.45	\$0.00		\$43,497.00	
The state of the s				and a second of	a country formation		A Assessment date to any	CARA ES
Jail		10 mm in 1 mm at 1 mm at						\$681,8
· Property of the same of the same of the same of		21,331 SF		\$14.15	\$0.00	Basement and Ground Floor	\$301,834.00	Andrew Printer
Metal Framing / GWB						AL REAL PROPERTY AND ADDRESS OF THE PARTY OF		
Porcelain Tile	140-47 A F 1 T 2 F 7 F FF 19	21,331 SF	_	\$2.25	\$0.00	Basement and Ground Floor	\$47,995.00	
ACT Ceiling		21,331 SF		\$3.50	\$0.00	Basement and Ground Floor	\$74,659.00	
LVT / Carpet		21,331 SF		\$4.80	\$0,00	Basement and Ground Floor	\$102,389.00	
Acoustical Wall Panels		21,331 SF		\$0.25	\$0.00	Basement and Ground Floor	\$5,333.00	
Painting	A 10 MAY 2 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	61,084 SF		\$2,45	\$0,00		\$149,656.00	
			-					
Magistrate				****** ***** *			The state of the state of	\$278,3
		8,360 SF		\$14.15	\$0.00		5118,294.00	441.00
Metal Framing / GWB							518,810.00	
Porcelain Tile		8,360 SF		\$2.25	\$0.00			
Wood Liner Celling		8,360 SF		\$4.50	\$0,00	T 18 1554714578 OF LANS. FIR	\$37,620.00	
ACT Ceiling		8,360 SF	[	\$3.50	\$0.00		\$29,260.00	
LVT / Carpet		B,360 SF		\$4.80	\$0,00		\$40,128.00	
Epoxy Terrazzo Flooring	4	8,360 SF		\$1,40	\$0,00		\$11,704.00	
+		8,360 SF		\$0.25	\$0.00	m m h c r h h r r h h h	\$2,090.00	*****
Acoustical Wall Panels	NAME AND ADDRESS OF THE PARTY O	8,360 SF		\$2.45	\$0.00		\$20,482.00	
Painting		15 005'0		\$2.45	50,00		920,402.00	
								- maraja mar
Garage			1					\$988,5
Metal Framing / GWB		31,585 SF	_ [	\$14.15	\$0.00	Office and Storage	\$446,928.00	
Porcelain Tile		31,585 SF	1	\$2.25	\$0.00	Office and Storage	\$71,066.00	
ACT Ceiling		31,585 SF		\$3.50	\$0.00	Office and Storage	\$110,548.00	
		31,585 SF	-	\$4.80	\$0.00	Office and Storage	\$151,608.00	
LVT / Carpet				the same of the same of the same of the same of	THE RESERVE AND ADDRESS OF THE PARTY NAMED IN	Office and Storage	\$208,409.00	
Painting		85,065 SF		\$2.45	\$0.00		\$208,409.00	mark 1 1
	an order to be a series and a							

Project Number: 19-0004

Condition Assessment Report Portsmouth Civic Center Complex

Project Name: Location: Portsmouth, VA Estimate Date: April 25, 2019 - REVISED

240,883 129 Area (SF): Duration (WK):

#### CLARKNEXSEN **Construction Services**

e)Asteriorora	26 996	DATE SUSCINITIONET	110/12	(5) UK (50.5) NOSTO
खेती।क्षे <u>र</u>				\$597,301
				\$85,400.
Police Headquarters			a 11H	THE RESERVE OF THE PARTY OF THE
Interior Signage	28,000 SF	\$0.45 \$0,00		\$12,600.00
Folding Partition Walls	28,000 SF	\$1.70 50.00		\$47,600.00
FRP at Janitor	28,000 SF	\$0.05 \$0.00		\$1,400.00
Tollet Partitions	28,000 SF	\$0.30 \$0.00		\$8,400.00
Toilet Accessories	28,000 SF	\$0.45 \$0.00	-	\$12,600 00
Fire Extinguishers and Cabinets	28,000 SF	\$0,10 \$0,00		\$2,800.00
File Extiligationers with Captivers	20,000 31			
Plaza Level		1 10 110		\$143,243
Wayfinding Signage	42,972 SF	\$0.25 \$0.00		\$10,743.00
Flag Poles	3 EA	\$15,000.00 \$0.00		\$45,000.00
Exterior Building Signage	5 EA	\$17,500.00 \$0.00		\$87,500.00
Exterior building signage	a ru	\$17,500.00	10.	ngle 1 day ye
Judicial Building A			1 42 4 12	\$123,891
Interior Signage	40,620 SF	\$0.45 50.00		\$18,279.00
Folding Partition Walls	40,620 SF	\$1.70 50.00	*	\$69,054,00
A CONTRACT OF THE PARTY OF THE	40,620 SF	\$0.05 \$0.00		\$2,031.00
FRP at Janitor			-	10 4 7 5 7 40 N
Toilet Partitions	40,620 SF	\$0.30 \$0.00	te I ii	512,186.00
Toilet Accessories	40,620 SF	\$0.45 \$0.00		518,279.00
Fire Extinguishers and Cabinets	40,670 SF	\$0.10 \$0.00		\$4,062.00
Judicial Building B	-	10.511	AT 151 P 44 -	\$54,149
	E1010 11	\$0.45 \$0.00	Yes	\$7,989.00
Interior Signage	17,754 SF	*****		
Folding Partition Walls	17,754 SF	\$1,70 50,00		\$30,182.00
FRP at Janitor	17,754 SF	\$0.05 \$0.00		\$888.00
Toilet Partitions	17,754 SF	\$0.30 \$0.00		\$5,326.00
Toilet Accessories	17,754 SF	\$0.45 \$0.00		\$7,989.00
Fire Extinguishers and Cabinets	17,754 SF	\$0.10 \$0.00		\$1,775.00
s as pre-area sum of all 1 s	(m = + (0), 1 4	7-1 va		Te de a
193				\$68,834
Interior Signage	61,084 SF	\$0,45 50,00		\$27,468.00
FRP at Janitor	61,084 SF	\$0.05 \$0.00		\$3,054.00
A MILL OF THE STATE OF THE STAT	15,652 SF	\$0.30 \$0.00	Ground Floor Only	\$4,696.00
Toilet Partitions			Gradina Flabr Gilly	
Tollet Accessories	61,084 SF	\$0.45 \$0.00	et e e e e e e e	\$27,488.00
Fire Extinguishers and Cabinets	61,084 SF	\$0.10 \$0.00	M . M	\$6,108.00
Magistrate				\$25,498
Interior Signage	8,360 SF	\$0.45 \$0.00		\$3,762.00
the state of the s	The section was a first	\$1.70 \$0.00	e ep	\$14,212.00
Folding Partition Walls	8,360 5F		No two Code Col.	
FRP at Janitor	8,360 SF	\$0.09 \$0.00		\$418.00
Toilet Partitions	8,360 SF	\$0.30 \$0.00		\$2,508,00
Toilet Accessories	8,360 SF	\$0.45 \$0.00		\$3,762.00
Fire Extinguishers and Cabinets	8,360 SF	\$0.10 \$0.00		\$836,00
			10 0001104	1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1
Garage	WINDS IN THE REAL PROPERTY.			\$46,786.
Interior Signage	85,065 SF	\$0.45 \$0.00		\$38,279.00
Fire Extinguishers and Cabinets	85,065 SF	\$0.10 \$0.00		\$8,507.00
A	101	e i (mail en les ales	= en=(1110) (10	4 144 144 4
THE R. P. LEWIS CO., LANSING MICH. S. LEWIS CO., LANSING, MICH. S. LEWIS CO., LANSING, MICH. S. L. S. P.	magazine of the part	represent to the self-terminal and the self-self-self-self-self-self-self-self-		
u gisalikus		The second second second	AND RESIDENCE AND REAL PROPERTY.	48-030-00 560-200

Project Number: Project Name:

19-0004 Condition Assessment Report Portsmouth Civic Center Complex

Location: Estimate Date:

Portsmouth, VA April 25, 2019 - REVISED

240,883 129 Area (SF): Duration (WK):

# CLARKNEXSEN **Construction Services**

्रा प्रकारित हो।	1 Possible Co	Pris 10	Ne I	Griff delete .	<b>Belowind</b>	Vital Addition	P. P. P.	Total day	iniOH)
nipment	A STATE OF THE STA	10 1 /1 1						325	mag
Police Headquarters None	P 100 20 20 20 20 20 20 20 20 20 20 20 20 2			\$0.00	50.00			\$6.00	\$0.0
Plaza Level None			100	\$0.00	\$0.00			50.00	\$0.
Judicial Ruilding A None				\$0.00	\$0.00			\$0.00	\$D.
Jurik in Brailding B None	- 1			\$0.00	\$0.00			\$0.00	50
None	4 4 - 4 - 4 - 4 - 4 - 4 - 4 - 4 - 4			\$0,00	\$0.00	3		\$0,00	\$0
Magistrate None				\$0.00	\$0.DI			\$0,00	50
Garage Parking Control Equipment	2 14 2 mm 14	1 13		\$25,000.00	\$0.0			\$25,000,00	25,000
			0-0	an - 40					METSA
Yests gatthey part		Section 1		MINE N		North Control	- 45	क्षेत्र विशेषक ।	ers top

Project Number: Project Name:

19-0004 Condition Assessment Report Portsmouth Civic Center Complex Portsmouth, VA April 25, 2019 - REVISED

Location:

Estimate Date:

Area (SF): Duration (WK): 240,883 129

## CLARKNEXSEN **Construction Services**

मेह्न(बीएसी)हर	THE WATE	THEOLOGICE SUBG	ENTREET	(XA(\$)	(6)60 (60)1	(horion)
ni nisningi.		DECEMBER 1				5101,700.0
Police Headouarters						\$29,400.0
Roller Shades	28,000 SF	\$1.00	\$0.00		\$28,000.00	\$25,400.0
Recessed Entry Mats	28,000 SF	\$0.05	50.00		\$1,400.00	
Plaza Level	5					\$0.0
None		\$0.00	\$0.00		\$0.00	100
Judicial Building A	OF STATE OF	-011-01			-	\$42,651.0
Roller Shades	40,620 SF	\$1.00	\$0.00		\$40,620.00	100
Recessed Entry Mats	40,620 SF	\$0.05	\$0.00		\$2,031.00	
Audicial Resilding &		-				\$18,642.0
Roller Shades	17,754 SF	\$1.00	50.00		\$17,754.00	440,000,0
Recessed Entry Mats	17,754 SF	\$0.05	\$0.00		\$888,00	
Jaj			-			62 222 0
Recessed Entry Mats	45,432 SF	\$0.05	\$0,00		\$2,272.00	\$2,272.0
Magistrate	-			400		\$8,778.00
Roller Shades	8,360 SF	\$1.00	\$0.00		\$8,360.00	\$8,778.00
Recessed Entry Mats	8,360 SF	\$0.05	\$0.00		\$418.00	
Sarage						\$0.00
None		\$0.00	\$0,00	The second secon	\$0.00	
					-	
		,				
ga rishganna		CONTRACTOR OF THE	-	DATE OF THE OWNER, THE	Saide Said	Sel philipse

Project Number:

19-0004 Condition Assessment Report Portsmouth Civic Center Complex Portsmouth, VA April 25, 2019 - REVISED

Project Name: Location: Estimate Date:

Area (SF): Duration (WK):

240,883 129

# CLARKNEXSEN **Construction Services**

Percentula.		TORY THERE	ONT DRIE	- SUBDINISATE		Terrell 6/15	Histor
กษองที่คุร รับสิ่งสหัส			L.		1 - 1 - 1 - 1 - 1 - 1 - 1 - 1 - 1 - 1 -	MET LINE OF	31,310,800.
	( E INFRESTI	H 1 4 5 4 10	( t = 0 = 0				
Police Headquarters	we a difficulty					A MARKET IN ARM	\$246,000
Remove Existing Elevator		2 EA	\$10,500.00	\$0.00	4	\$21,000.0	NO. OF P. LANS.
Elevators		6 STOP	\$35,000.00	\$0.00		\$210,000.0	D
Temporary Use of Elevators		6 MO	\$2,500.00	\$0.00	the same	\$15,000.0	0
			1 4 4 4				w h
Plaza Level	1044 40 000						\$1
None			\$0.00	\$0.00		50.0	a
Judicial Building A							\$246,000
Remove Existing Elevator		Z EÂ	\$10,500.00	\$0.00		\$21,000.0	1
Elevators		6 STOP	\$35,000.00	\$0.00	-	\$210,000.0	
makes a market at a	1 4 4		Commander the Street	The state of the s			TT 1 1
Temporary Use of Elevators		6 MO	\$2,500.00	\$0.00		\$15,000.0	<del>_</del>
st ++ f r- r-	1 1 1 1 1 1 1 1	E	relation	100	the contract of	1 44 2 1	**** *** *** ***
Judicial Building B	Prince and the second	5 50mm to 60	53, 435, 5	4 - 5 5		· · · · · · · · · · · · · · · · · · ·	\$130,500
Remove Existing Elevator		1 EA	\$10,500.00	50.00		\$10,500.0	Man A III A HA A I
Elevators	10 a 1 = 1	3 STOP	\$35,000.00	\$0.00		\$105,000.0	AREA A.A. III AREA
Temporary Use of Elevators	***	6 MO	\$2,500.00	50.0p		\$15,000.00	
Age to a real first							
lall							\$908,000
Remove Existing Elevator		2 EA	\$31,500.00	50.00		\$63,000.00	)
Elevators - Traction		18 STOP	\$45,000,00	\$0.00		\$810,000.00	3
Temporary Use of Elevators	1914 14 4 4	14 MO	\$2,500,00	\$0.00		\$35,000.00	ð
Magistrate							51
None			\$0,00	\$0.00		\$0.00	
	4 4-		2/2.	457	- 4 44		
Saraeg		at a			1 **		sc
None			50.00	\$0.00		\$0.00	mark man the
Manue			\$0.00	50.00		30.00	
						- 1 2 25 10	
ar charle man are sold						21.200,500	0 3430000